Product sheet Miniature connector




Product

Pole


Contacts: 14, Cable plug connector with cable clamp, shieldable, cable outlet 4 – 6 mm, with UL approval 14

Area Article number M16 IP67 Series 423 99 5451 00 14



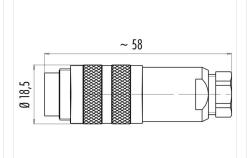


Scale drawing

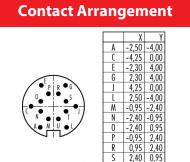

2.40 -0.95

Attenuation characteristic

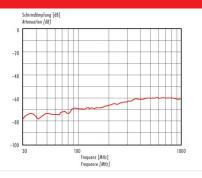

You can find the item description and assembly instruction on the next page.

Technical data

Common values

Connector Design Connector locking system Termination Wire gauge (mm) Wire gauge (AWG) Cable outlet Upper temperature Lower temperature

Cable plug connector screw Solder 0.25 mm² 24 4 - 6 mm 95 °C -40 °C

Electrical values

Rated voltage Rated impulse voltage Pollution degree Overvoltage category Material group Rated current (40°C) Volume resistivity EMV compliance Degree of protection Mechanical operation

Material

Material of contact Contact plating Material of contact body Material of housing $\begin{array}{l} \text{60 V} \\ \text{500 V} \\ 1 \\ \text{I} \\ \text{II} \\ 3 \text{A} \\ \leq 3 \text{ m} \\ \text{shielded} \\ \text{IP67} \\ > \text{500 mating cycles} \end{array}$

CuZn (Brass) Au (Gold) PBT (UL 94 V-0) CuZn (Brass nickel-plated)

Contacts: 14, Cable plug connector with cable clamp, shieldable, cable outlet 4– 6 mm, gold plated contacts, with UL approval



Product sheet Miniature connector




Product

Pole

Contacts: 14, Cable plug connector with cable clamp, shieldable, cable outlet 4 – 6 mm, with UL approval 14

Area Article number M16 IP67 Series 423 99 5451 00 14

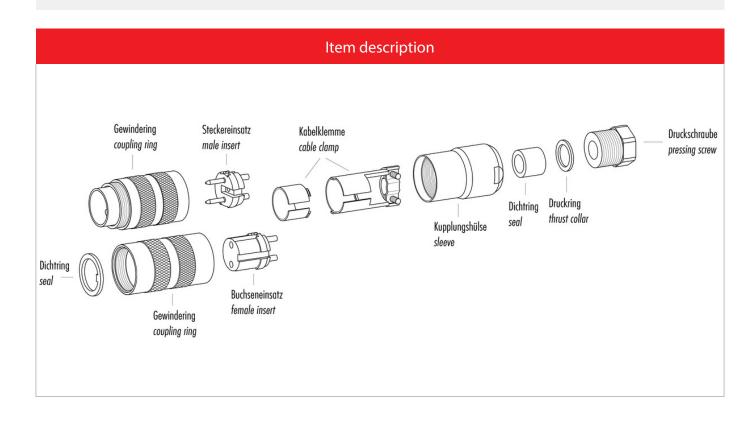

Installation instructions / Mounting cutout

Gerade Version

(Ausführung mit Schirmklemmring)

- Druckschraube, Klemmkorb, Dichtung, Distanzhülse und ersten Schirmklemmring auffädeln.
- 2. Litzen abisolieren, Schirm aufweiten und zweiten Schirmklemmring auffädeln.
- Litzen anlöten, Distanzhülse montieren, die beiden Klemmringe mit dem Schirm zusammenschieben und überstehenden Schirm abschneiden.
- 4. Übrige Teile gemäß Darstellung montieren.

Straight version

(Version with shield clamping ring)

- 1. Bead pressing screw, pinch ring, seal, distance shell and first shield clamping ring on cable.
- 2. Strip wires, widen shield and bead second shield clamping ring.
- Solder wires, snap distance shell, push the two shield clamping rings together and cutt off projecting shielding braid.
- 4. Assemble remaining parts according to picture.

