#### **Product sheet**

## Miniature connector



Product

Contacts: 4, Female cable connector, short version, cable outlet 4 - 8 mm, with UL

Article number


Area


M16 IP67 Series 423 99 5110 40 04

Pole

4



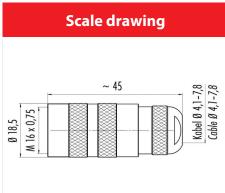

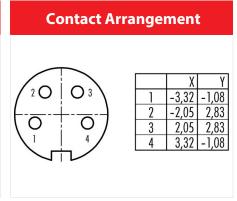

You can find the item description and assembly instruction on the next page.

# **Technical data**

#### **Common values**

Connector Design Connector locking system Termination Wire gauge (mm) Wire gauge (AWG) Cable outlet Upper temperature Lower temperature Female cable connector screw Solder 0.75 mm<sup>2</sup> 20 4 - 8 mm 95 °C -40 °C

### **Electrical values**

Rated voltage 250 V Rated impulse voltage 1500 V Pollution degree Overvoltage category Material group Ш Rated current (40°C) 6 A Volume resistivity  $\leq$  3 m $\Omega$ EMV compliance not shielded Degree of protection IP67 Mechanical operation > 500 mating cycles

### Material

Material of contact Contact plating Material of contact body Material of housing CuSn (Bronze) Au (Gold) PBT (UL 94 V-0) CuZn (Brass nickel-plated)

Contacts: 4, Female cable connector, short version, cable outlet 4 - 8 mm, gold plated contacts, with UL approval

#### **Product sheet**

## Miniature connector



Product


Contacts: 4, Female cable connector, short version, cable outlet 4 - 8 mm, with UL approval

Article number

Area

M16 IP67 Series 423 99 5110 40 04

Pole

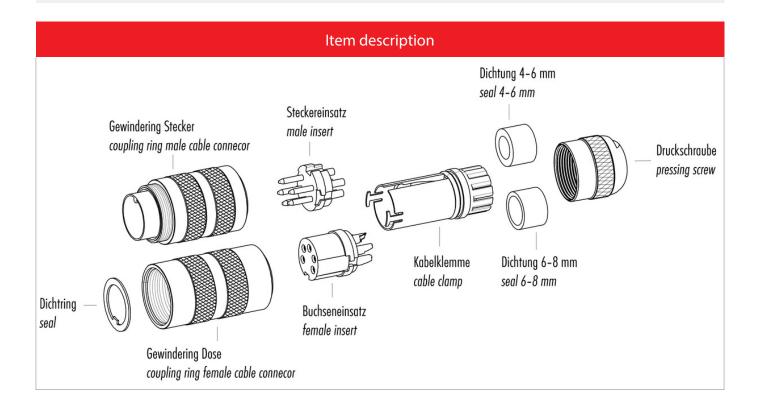

# Installation instructions / Mounting cutout

#### **Gerade Version**

(Ausführung mit Schirmklemmring)

- Druckschraube, Klemmkorb, Dichtung, Distanzhülse und ersten Schirmklemmring auffädeln.
- 2. Litzen abisolieren, Schirm aufweiten und zweiten Schirmklemmring auffädeln.
- Litzen anlöten, Distanzhülse montieren, die beiden Klemmringe mit dem Schirm zusammenschieben und überstehenden Schirm abschneiden.
- 4. Übrige Teile gemäß Darstellung montieren.

### Straight version

(Version with shield clamping ring)

- 1. Bead pressing screw, pinch ring, seal, distance shell and first shield clamping ring on cable.
- 2. Strip wires, widen shield and bead second shield clamping ring.
- Solder wires, snap distance shell, push the two shield clamping rings together and cutt off projecting shielding braid.
- 4. Assemble remaining parts according to picture.

